TAP Plastics • tapplastics.com PRODUCT BULLETIN 15 Formula Five® Clean N Glaze

Formula Five® Clean N Glaze is a mild buffing compound recommended as part of a multi-cycle process designed to ease the release of parts from gel-coated mold surfaces.

It is not a cutting compound and may be used safely on all production molds and plugs.


Formula Five® Clean N Glaze increases production efficiency by accomplishing two steps in one. Fine scratch marks and surface hazing are removed from the mold surface while at the same time a durable, high-luster foundation is laid for the releasing wax. It is recommended that Formula Five® Mold Release Wax be used in conjunction with Formula Five® Clean N Glaze.

Preparation of Mold Surface

Mold surface should be thoroughly clean and free of other parting agents prior to the application of **Formula Five Clean N Glaze**.

Formula Five Clean N Glaze is not recommended for use on high porosity mold surfaces such as plaster or wood.

Application of Formula Five® Clean N Glaze

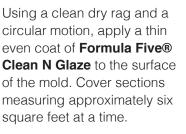



Excess should be wiped away with another clean dry rag.

Begin buffing immediately with a power buffer. It is recommended that the power buffer be equipped with a terry cloth or cotton pad.

Keep the power buffer moving constantly so as not to allow a buildup of friction that could burn through surface coating.

Surface should be buffed to a glossy finish. Any remaining haze or residue may be removed using a wet cotton cloth or sponge.

View all of TAP's how-to videos on plastic, fiberglass, mold-making, window films, and more at: http://www.tapplastics.com/product_info/videos



Formula Five® Mold Release Wax may be applied to mold surface following buffing. An occasional reapplication of Formula Five® Clean N Glaze will assist in maintaining a trouble free mold.

Removing Part from Mold

The best procedure for separating the part from the mold depends on the size and shape of the part. In most cases the part can be lifted from the mold after loosening around the edges. A jet of air between the part and the mold at the edge is sometimes useful. On large curved parts it may be necessary to first tap over the surface with a rubber mallet. A very strong blast of air (or a few squirts with a CO2 extinguisher) will free very rigid parts that cannot be flexed.

Parts should fall away easily from a well-conditioned mold. Using **Formula Five® Clean N Glaze** regularly can aid in the conditioning process, resulting in fewer parting problems and more efficient production cycles

The information and recommendations contained in this bulletin are, to the best of our knowledge, accurate and reliable. No guarantee of their accuracy is made, however, and the products discussed are sold without warranty, express or implied, and upon conditions that the purchasers shall make their own tests to determine the suitability of such products for their particular purposes and uses.

TAP Plastics

🗅 Bellevue WA	12021 NE Northup Way	425 861-0940
El Cerrito CA	10760 San Pablo Avenue	510 778-9057
Fremont CA	5160 Mowry Avenue	510 796-3550
Lynnwood WA	4232 196th St. SW	425 977-4440
🗅 Mountain View CA	312 Castro Street	650 962-8430
Pleasant Hill CA	1478 Contra Costa Blvd	925 798-0420
Pleasanton CA	6010-C Johnson Drive	925 460-8214
Portland OR	2842 NE Sandy Blvd	503 230-0770
Sacramento CA	4538 Auburn Blvd	916 481-7584
Sacramento CA	4506 Florin Road	916 429-9551
🗆 San Francisco CA	154 S. Van Ness Ave	415 864-7360
🗆 San Jose CA	1212 The Alameda	408 292-8685
🗆 San Jose CA	1008 Blossom Hill Rd	408 265-6400
🗆 San Leandro CA	3011 Alvarado Street	510 357-3755
🗆 San Mateo CA	606 South B Street	650 344-7127
🗆 San Rafael CA	900 Andersen Drive	415 454-6393
🗆 Santa Rosa CA	2770 B Santa Rosa Ave	707 544-5772
Seattle WA	710 9th Avenue North	206 389-5900
Stockton CA	1859 Pacific Avenue	209 937-9300
🗆 Tigard OR	15957 SW 72nd Avenue	503 620-4960
Printed on recycled paper.	Corporate Office • San Leandro CA • (510) 895-8249	

the fantastic plastic place